




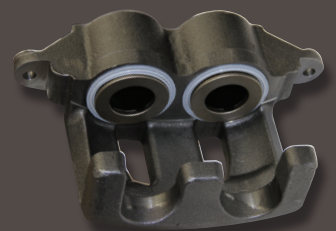


HEAVY DUTY AIR AND HYDRAULIC DISC BRAKES

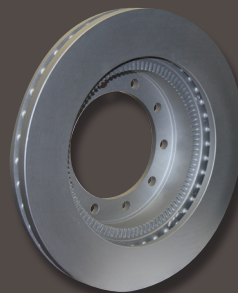

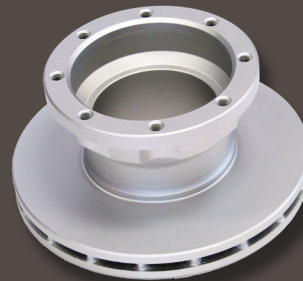

DISC PADS

- Everything you look for from a brake pad with our **CERAMIC ENHANCED DRY FORMULATION**
- Excellent Performance • Longer Pad Life • Quiet Drive
- Designed to perform in high heat and severe service applications

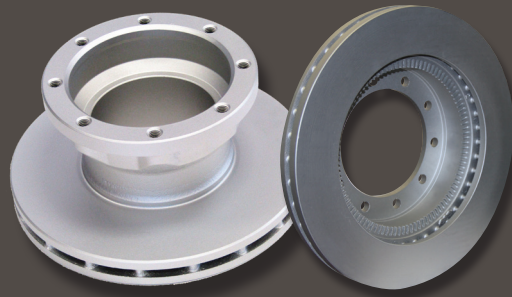

ROTORS

- High carbon alloy grey iron for **ULTIMATE HEAT DISSIPATION**
- Precision mill balanced for higher performance
- Geomet® Coated for corrosion protection and longer life



CALIPERS

- New or remanufactured to the tightest OEM tolerances
- **NO CORES CHARGES!**



Premium Air Disc Brake Pads

GoldForce Air Disc Pad # (SD: Severe Duty)	Used with Caliper App.	Replaces Disc Pad Set Cross Reference #'s			Matching GoldForce Air Disc Rotor #	Matching GoldForce Air Disc Caliper #
		Bendix #	Meritor #	OEM #		
GFP1203KV	Bendix SB7 or SN7	5013257 K109249 K109319 K046771K50	MMD1203AF	N8893599 611049		
GFP1203SD	Bendix SB7 or SN7 Severe Duty	K109318 K006060				
GFP1310KV	Meritor Elsa-2		68324558 68325344 68325346 68325901	N508206051, N508206052 20976509, 21309468, 85107768		
GFP1311KV	Meritor EX225H	AMPM1311BA	MMD1311AF	04-01-1113	GFR56641G GFR56642G GFR76606G	
GFP1311SD	Meritor EX225H Severe Duty		KIT2252HBA KIT2252H2CE KIT2252H2DA KIT2252H2DA-2		GFR56641G GFR56642G GFR76606G	
GFP1312KV	Meritor D-Lisa	AMPM1312BA	MDP5019 MDP5025 MDP5042 MDP5061	04-01-1007, 04-01-1019, 20825594, 3093919, 3093939, 85105485, 85506111,		
GFP1369KV	Bendix ADB22X™	802078 K070796	MMD1369AF		GFR76617G GFR76618G GFR76692G	GFADC109961X, GFADC109962X, GFADC109957X, GFADC109958X, GFADC113887X, GFADC113888X, GFADC012341X, GFADC012342X
GFP1369SD	Bendix ADB22X™ Severe Duty	K109113			GFR76617G GFR76618G GFR76692G	GFADC109961X, GFADC109962X, GFADC109957X, GFADC109958X, GFADC113887X, GFADC113888X, GFADC012341X, GFADC012342X
GFP1370KV	Meritor EX225L	AMPB1370BA	MMD1370AF GMD1370AF		In Development	GFADCEXL201, GFADCEXL202 (most common)
GFP1370SD	Meritor EX225L		KIT2252L2CG		In Development	GFADCEXL201, GFADCEXL202 (most common)
GFP1407KV	Meritor D-Elsa 1	AMPM1407BA	MDP5017, MDP5038, MDP5041, MDP5054, MDP5065, MDP5090, MDP5091, MDP5110, MDP5031,	N508206035 N508206044		
GFP1438KV GFP1438SD	Wabco PAN19	AMPW1438BA	MMD1438AF	12999737	GFR71601G	GFADCW95037 GFADCW95038
GFP1518KV GFP1518SD	Wabco PAN17	AMPW1518BA	MMD1518AF	12999808	GFR75180G	GFADCW75072 GFADCW75073
GFP1708KV	Meritor ELSA225-3	AMPM1708BA				
GFP1708SD	Meritor ELSA225-3		KIT2252HVPB KIT2252HBM7070 KIT2252HBMA703 KIT2252HBMA9500			
GFP1777KV GFP1777SD	Wabco PAN22	AMPW1777BA	MMDWP22AF	12999796	GFR76613G	GFADCW25015 GFADCW25016 GFADCW50800 GFADCW50810
GFP2061KV	Wabco Maxxus (Freightliner)	AMPW2061BA		640 322 934 2	GFR20109G	



Premium Air Disc Brake Rotors

GoldForce Air Disc Rotor #	Used with Caliper App.	Replaces Rotor Cross Reference #'s				Matching GoldForce Air Disc Pad #	Matching GoldForce Air Disc Caliper #
		Bendix #	Meritor #	OEM #	Wabco #		
GFR76618G	Bendix ADB22X™	802081 K038573	M44D76618			GFP1369KV GFP1369SD	GFADC109961X GFADC109962X GFADC109957X GFADC109958X
GFR76617G	Bendix ADB22X™	802082 K038574	M44D76617			GFP1369KV GFP1369SD	GFADC109961X GFADC109962X GFADC109957X GFADC109958X
GFR76692G	Bendix ADB22X™	802569	M44D76692			GFP1369KV GFP1369SD	GFADC109961X GFADC109962X GFADC109957X GFADC109958X
GFR56641G	Meritor EX225		68326014	15-02-1067 15-02-1043		GFP1311KV GFP1311SD	
GFR56642G	Meritor EX225		23-123642-002	15-03-1012		GFP1311KV GFP1311SD	
GFR76606G	Meritor EX225		23-123647-002			GFP1311KV GFP1311SD	
GFR75180G	Wabco PAN17		M44AD75180		CT826	GFP1518KV	GFADCW75072 GFADCW75073
GFR71601G	Wabco PAN19		M44D71601		CT832	GFP1438KV	GFADCW95037 GFADCW95038
GFR76613G	Wabco PAN22		M44D76613		CT807	GFP1777KV	GFADCW25015 GFADCW25016 GFADCW50800 GFADCW50810
GFR20109G	Wabco Maxxus			10020109 10020682		GFP2061KV	



Premium Air Disc Brake Calipers

GoldForce Air Disc Caliper #	Vehicle Application	Replaces Caliper Cross Reference #'s		Matching GoldForce Air Disc Pad #	Matching GoldForce Air Disc Rotor #
		Bendix / Meritor / Wabco #	OEM #		
GFADC012341X	Bendix ADB22X™ SAF Axle (LH)	K012341X 0308006001Z	S-29152-16	GFP1369KV GFP1369SD	
GFADC012342X	Bendix ADB22X™ SAF Axle (RH)	K012342X 03080005901Z	S-29152-17	GFP1369KV GFP1369SD	
GFADC109957X	Bendix ADB22X™ Freightliner (RH)	K109957X K081256	K109957X K081256 K021299	GFP1369KV GFP1369SD	GFR76617G GFR76618G GFR76692G
GFADC109958X	Bendix ADB22X™ Freightliner (LH)	K109958X K081257	K109958X K081257 K021300	GFP1369KV GFP1369SD	GFR76617G GFR76618G GFR76692G
GFADC109961X	Bendix ADB22X™ Navistar/Kenworth/Peterbilt/Volvo/Mack (RH)	K109961X K081142	K109961X K081142 802090	GFP1369KV GFP1369SD	GFR76617G GFR76618G GFR76692G
GFADC109962X	Bendix ADB22X™ Navistar/Kenworth/Peterbilt/Volvo/Mack (LH)	K109962X K081143	K109962X K081143 802091	GFP1369KV GFP1369SD	GFR76617G GFR76618G GFR76692G
GFADC113887X	Bendix ADB22X™ Hendrickson Trailer (RH)	K113887X 802984 S-29152-14	K113887X 802984 S-29152-14	GFP1369KV GFP1369SD	GFR76692G plus others in development
GFADC113888X	Bendix ADB22X™ Hendrickson Trailer (LH)	K113888X 802985 S-29152-15	K113887X 802985 S-29152-15	GFP1369KV GFP1369SD	GFR76692G plus others in development
GFADCEXH201	Meritor EX225H (RH)	EX225H201XX000 EX225H201R		GFP1311KV GFP1311SD	GFR56641G GFR56642G GFR76606G
GFADCEXH202	Meritor EX225H (LH)	EX225H202XX000 EX225H202R		GFP1311KV GFP1311SD	GFR56641G GFR56642G GFR76606G
GFADCEXH301	Meritor EX225H (RH)	EX225H301XX000 EX225H301R		GFP1311KV GFP1311SD	GFR56641G GFR56642G GFR76606G
GFADCEXH302	Meritor EX225H (LH)	EX225H302XX000 EX225H302R		GFP1311KV GFP1311SD	GFR56641G GFR56642G GFR76606G
GFADCEXL201	Meritor EX225L (RH)	EX225L201XX000 EX225L201R		GFP1370KV GFP1370SD	In Development
GFADCEXL202	Meritor EX225L (LH)	EX225L202XX000 EX225L202R		GFP1370KV GFP1370SD	In Development
GFADCW75072	Wabco PAN 17 (LH)	40175072, 40175090, 640175072R	S-36837-7 S-39094-L	GFP1518KV GFP1518SD	GFR75180G
GFADCW75073	Wabco PAN 17 (RH)	40175073, 40175091, 640175073R	S-36837-8 S-39094-R	GFP1518KV GFP1518SD	GFR75180G
GFADCW95037	Wabco PAN 19 (LH)	40195037, 40195027, 640195037R	S-36838-7 S-39093-L	GFP1438KV GFP1438SD	GFR71601G
GFADCW95038	Wabco PAN 19 (RH)	40195038, 40195028, 640195038R	S-36838-8 S-39093-R	GFP1438KV GFP1438SD	GFR71601G
GFADCW25015	Wabco PAN 22 Ridewell/AXN/Reyco/Granning/IMT (LH)	40225015, 40225011, 640225015R	3080005100	GFP1777KV GFP1777SD	GFR76613G
GFADCW25016	Wabco PAN 22 Ridewell/AXN/Reyco/Granning/IMT (RH)	40225016, 40225012, 640225016R	3080005000	GFP1777KV GFP1777SD	GFR76613G
GFADCW50800	Wabco PAN 22 Hendrickson/Meritor (LH)	6402250800 6402250360	S-33648-2 S-32676-7	GFP1777KV GFP1777SD	
GFADCW50810	Wabco PAN 22 Hendrickson/Meritor (RH)	6402250810 64002250370	S-33648-3 S-32676-8	GFP1777KV GFP1777SD	



Shear Nut #: GFHK1369-SN

Replaces Bendix 802455 and Hendrickson S-29152-5



Premium Hydraulic Disc Brake Pads

GoldForce Hydraulic Pad # (SD: Severe Duty)	Overall Length	Overall Width	Friction Thickness (Includes Plate)	Replaces Disc Pad Set Cross Reference #'s			GoldForce Hydraulic Caliper #
				Bendix / Formula Blue	Meritor	Performance Friction	
GFP184CE GFP184SD	254.0mm (10.03") 205.0mm (8.07")	97.5mm (3.83") 80.0mm (3.15")	16.0mm (.63") 21.8mm (.85")	E10901840	MD184 MD380 MMD380	0184.10	GFC55314
GFP224CE	213.4mm (8.40")	101.5mm (3.96")	18.5mm (.73")	E11102240	MD224 MMD224	0224.10	GFC55251
GFP225CE GFP225SD	269.5mm (10.61") 205.0mm (8.07")	100mm (3.93") 80.0mm (3.15")	22.3mm (.87") 26.5mm (1.04")	E11102250	MD225 MMD225	0225.10	GFC55250
GFP236CE	228.6mm (9.00")	102.6mm (4.04")	25.1mm (.98")	E11102360	MD236 MMD236	0236.20	GFC55252
GFP769CE GFP769SD (replaces D1032, D1418)	240.0mm (9.45") 240.0mm (9.45") 240.0mm (9.45")	88.64mm (3.49") 88.64mm (3.49") 88.64mm (3.49")	25.2mm (1.00") 25.2mm (1.00") 25.2mm (1.00")	E1107690	MD769 MMD769 MVD769 KIT769AM KITD769GM	0769.10	GFC13706-7 GFC14684012-3
GFP786CETK GFP786SDTK	244.1mm (9.61")	85.09mm (3.35")	26.8mm (1.05")	E10997861 E121107861	MD786 MMD786 MD786M MVD786	0786.11 0786.13 0786.23	GFC55850
GFP786ACETN GFP786ASDTN	244.1mm (9.61")	85.09mm (3.35")	20.3mm (.80")	E11107860	MD786A MMD786A MD786AM MVD786A	0786.10 0786.12 0786.20	GFC55849
GFP1066CE CFP1066SD	222.0mm (8.74")	64.50mm (2.54")	20.3mm (.80")	E11110660	MD1066	1066.10	GFC147076 GFC147077



Premium Hydraulic Disc Brake Rotors

GoldForce Hydraulic Rotor #	Application	Dimensions	Specs	Replaces Rotor Cross Reference #'s					
				Bendix	Gunite	Meritor	OEM #	Performance Friction	Webb
GFR141394G	Dodge/Ford/Sterling Rear/ Ford LCF/IHC Front/Rear	15.35 X 4.88	10 Hole 0.50	E12570120			2608016C1 141394		
GFR19996G	Ford Front/Rear, IHC Front/Rear	15.35 X 1.91	10 Hole 0.53	E12588025		R4483020	2599937C91 10019996 10020611	390.048.20	
GFR54102G	GM Front	14.75 X 3.81	5 Hole 0.66	141271 E12585013	D6054	122687	15515768 15619954		54102P
GFR54104G	GM/Chevrolet Front	14.75 X 3.81	6 Hole 0.66	141585 E12685009	D6054A	122688			54104P
GFR54105G	Ford Front ABS	14.75 X 3.81	6 hole 0.78	E12584020		123480			54105P
GFR54301G	GM Front/Rear	15.39 X 3.40	10 Hole 0.59	141272 E12585006	D6052	122729	155144016 156199700		54301P
GFR54365G	Thomas Bus/Bluebird Bus/Ford	15.39 X 7.60	10 hole 0.94 U-Rotor C/W ABS			123574		390.193.20	54365P-65
GFR54769G	Navistar Front ABS Application	15.00 X 3.50	5 Hole 0.78	141476 E12588021		123573	2594594C1	381.089.20	54769P-65
GFR54770G	IHC Front/Rear ABS Application	15.00 X 3.50	6 hole 0.78	141475 E12588020	D6194AM	123572	164677C1 2505097C1	381.089.30	54770P-65
GFR54771G	Ford/Freightliner/Navistar/Ken- worth/Peterbilt/Sterling/Blue Bird	15.00 X 4.44	10 Hole 0.59	141494 E12588018	D6183M	123552	2594596C1	381.113.20	54771P-65
GFR54773G	Ford/Freightliner/Navistar/Ken- worth/Peterbilt/Sterling/Blue Bird	15.00 X 3.20	10 Hole 0.58	E12588019	D6176M	123550	2594595C1	381.081.20	54773P-65
GFR54775G	GM Front/Rear Bluebird Front/ Thomas Front/Rear	15.38 X 3.40	10 Hole 0.58	E12585019		123557		390.086.20	54775P-65
GFR6178AMG	Thomas Bus/Bluebird Bus, Freightliner/Peterbilt/Kenworth	15.00 X 7.11	10 hole 1.06 U-Rotor C/W ABS		D6178AM			381.181.20	



Premium Hydraulic Disc Brake Calipers

GoldForce Hydraulic Caliper #	Description	Application	Yrs Used	Replaces Caliper Cross Reference #'s		Disc Pad Application	
				Bendix	Euclid	Performance Friction	GoldForce Hydraulic Pad # (SD: Severe Duty)
GFC13706-7	70mm Meritor R/L 3-hole	IHC/Ford	2009-2017	E14688014 E14688015	E-13706 E-13707	0769.10	GFP769CE GFP769SD
GFC14684012-3	70mm Meritor R/L 2-Hole	GM/Freightliner/ Sterling/Thomas	2000-2013	E14684012/3/8/9 E14685010/1/20/21	E-11733-SL E-11734-SL	0769.10	GFP769CE GFP769SD
GFC147076	60mm TRW Right	IHC/Ford	2005-2016	E14670076	E-12253	1066.10	GFP1066CE CFP1066SD
GFC147077	60mm TRW Left	IHC/Ford	2005-2016	E14670077	E-12254	1066.10	GFP1066CE CFP1066SD
GFC55250	2.88" Bendix	IHC/Freightliner/ Thomas	1979-2008	R55250 E14685008	E-4238X	0225.10	GFP225CE GFP225SD
GFC55251	2.5" Dayton Walther	GM/Ford/Meritor	1979-2008	R55251 E14684106	E-11117X	0224.10	GFP224CE
GFC55252	2.88" Dayton Walther	Ford	1983-1999	R55252 E14684006	E-4245X	0236.20	GFP236CE
GFC55314	2.60" Bendix	IHC/Freightliner/ Thomas	1990-2004	R55314 E14675007	E-4237X	0184.10	GFP184CE GFP184SD
GFC55849	66mm Bosch	IHC/Freightliner/ Sterling/Thomas	1985-2016	R55849 E14688008	E-11750X	0786.10 0786.12 0786.20	GFP786ACETN GFP786ASDTN
GFC55850	73mm Bosch	IHC/Freightliner/ Sterling/Thomas	1998-2016	R55850 E14688010	E-11756X	0786.11 0786.13 0786.23	GFP786CETK GFP786SDTK

GoldForce is a registered trademark of Tranznext Transportation Products. AXN, Bendix, Bendix ADB22X™, Blue Bird, Bosch, Chevrolet, Dayton Walther, Dodge, Eaton, Ford, Freightliner, GM, Granning, Hendrickson, IHC, IMT, Kenworth, Mack, Meritor, Navistar, Peterbilt, Reyco, Ridewell, SAF, Sterling, Thomas, TRW, Volvo and Wabco are registered trademarks of their respective companies. Any references in this catalogue to company names or trademarks are solely for identification and cross reference purposes and implies no rights of ownership by Tranznext Transportation Products.